

GOODING MUNI (GNG)(KGNG) 3 SW UTC-7(-6DT) N42°55.03' W114°45.91'**SALT LAKE CITY**

3732 B NOTAM FILE BOI

L-11C

RWY 07-25: H4745X75 (ASPH) S-30 MIRL 1.4% up NE

IAP

SERVICE: S4 FUEL 100LL, JET A OX 1, 2, 3, 4 LGT ACTIVATE MIRL

Rwy 07-25—CTAF. 3 clicks medium ints-5 clicks high ints.

AIRPORT REMARKS: Attended 1500-0000Z. For arpt attendant after hrs call 208-539-5934 or 208-934-8298. Considerable helicopter ops.**AIRPORT MANAGER:** 208-934-5934**COMMUNICATIONS:** CTAF/UNICOM 122.8

BLISS RCO 122.4 (BOISE RADIO)

SALT LAKE CENTER APP/DEP CON 118.05

RADIO AIDS TO NAVIGATION: NOTAM FILE TWF.

TWIN FALLS (L) VORTACW 115.8 TWF Chan 105 N42°28.79'

W114°29.37' 317° 28.9 NM to fld. 4140/18E.

VOR portion unusable:

115°-160° byd 30 NM blo 11,000'

115°-160° byd 33 NM blo 12,000'

TACAN AZIMUTH & DME unusable:

105°-160° byd 20 NM blo 15,000'

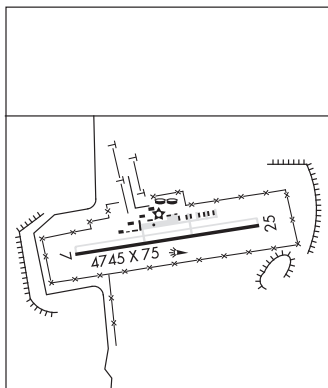
STEELHEAD NDB (MHW) 211 HDG N42°54.97'

W114°40.45' 255° 4.0 NM to fld. 3622/16E. NOTAM FILE

BOI.

NDB unusable:

Byd 15 NM

**GRAHAM USFS** (See ATLANTA on page 31)**GRANGEVILLE****IDAHO CO** (GIC)(KGIC) 1 N UTC-8(-7DT) N45°56.56' W116°07.38'**GREAT FALLS**

3313 B NOTAM FILE BOI

H-1C, L-13B

RWY 08-26: H5100X75 (ASPH) S-75, D-95, 2D-145 MIRL

IAP

0.4% up E

RWY 08: REIL. Road.**SERVICE:** S2 FUEL 100LL, JET A LGT ACTIVATE REIL Rwy 08—CTAF.

MIRL Rwy 08-26 operates continuously.

AIRPORT REMARKS: Unattended. 24 hr self svc credit card fueling facility.

Parachute activity May thru Aug. Wildlife in vicinity. Be aware mowing all sfcs. Considerable USFS fire retardant ops during summer months.

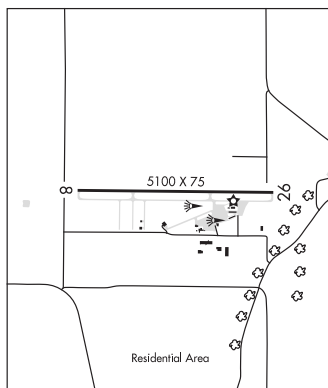
AIRPORT MANAGER: 208-983-1565**WEATHER DATA SOURCES:** AWOS-3 118.175 (208) 983-0306.**COMMUNICATIONS:** CTAF 122.8

® SEATTLE CENTER APP/DEP CON 123.95

RADIO AIDS TO NAVIGATION: NOTAM FILE MYL.

DONNELLY (H) VORW/DME 116.2 DNJ Chan 109 N44°46.03'

W116°12.38' 344° 70.6 NM to fld. 7333/19E.

**GRASMERE** (U91) 0 S UTC-7(-6DT) N42°22.40' W115°52.77'**SALT LAKE CITY**

5144 NOTAM FILE BOI

RWY 05-23: 2750X150 (TURF-DIRT) 0.6% up SW**RWY 05:** Fence.**AIRPORT REMARKS:** Unattended. No winter maintenance. No telephone avbl at arpt. Rwy 05-23 sfc may be poor due to damage by livestock, ground vehicles and rodents. Rwy 05, 4' fence at 90° on centerline, 7' road at 150° on center, 65' marked powerline at 900° on centerline. Rwy 05-23 edges and thlds marked with white rocks.**AIRPORT MANAGER:** 208-334-8775**COMMUNICATIONS:** CTAF 122.9