

ALLIANCE MUNI (AIA)(KAIA) 3 SE UTC-7(-6DT) N42°03.19' W102°48.23'CHEYENNE
H-5A, L-12G
IAP, AD

3931 B Class III, ARFF Index A NOTAM FILE AIA
RWY 12-30: H9203X150 (ASPH-AFSC) S-98, D-285, 2D-158,
 2D/2D2-321 PCR 39 R/B/W/T MIRL
RWY 12: REIL. VASI(V4L)—GA 3.0° TCH 39'.
RWY 30: MALSR. PAPI(P4L)—GA 3.0° TCH 53'.
RWY 17-35: H6311X75 (ASPH) S-24, D-30 PCR 39 R/B/W/T
RWY 08-26: H6190X75 (ASPH-PFC) S-36, D-48, 2D-80
 PCR 39 R/B/W/T MIRL

RUNWAY DECLARED DISTANCE INFORMATION

RWY 08: TORA-6190 TODA-6190 ASDA-6190 LDA-6190
RWY 12: TORA-9203 TODA-9203 ASDA-9203 LDA-9203
RWY 17: TORA-6311 TODA-6311 ASDA-6311 LDA-6311
RWY 26: TORA-6190 TODA-6190 ASDA-6190 LDA-6190
RWY 30: TORA-9203 TODA-9203 ASDA-9203 LDA-9203
RWY 35: TORA-6311 TODA-6311 ASDA-6311 LDA-6311

SERVICE: S4 FUEL 100LL, JET A LGT Actvt MALSR Rwy 30; REIL Rwy
 12; VASI Rwy 12; PAPI Rwy 30; MIRL Rwy 12-30 and Rwy
 08-26—CTAF.

AIRPORT REMARKS: Attended continuously. Migratory waterfowl on and in/ovf
 arpt. Ultralight and glider ops on and in/ovf arpt. Haying ops on interior
 of arpt during summer months. Rwy 08-26 designated calm wind.

Aerial spraying ops on and in/ovf arpt. Occasional use by acft with no radio. Back taxiing. Rwy 17-35 unavbl for use by
 air carriers. Rwy 17-35 not avbl for sked acr opns with more than 9 psgr seats or unsked acr at least 31 psgr seats.

AIRPORT MANAGER: 308-762-4512

WEATHER DATA SOURCES: ASOS 135.075 (308) 762-1221.

COMMUNICATIONS: CTAF/UNICOM 123.0

RCO 122.3 (COLUMBUS RADIO)

® DENVER CENTER APP/DEP CON 127.95

CLEARANCE DELIVERY PHONE: For CD if una to ctc on FSS freq, ctc Denver ARTCC at 303-651-4257.

RADIO AIDS TO NAVIGATION: NOTAM FILE AIA.

(VL) (DH) VOR/DME 111.8 AIA Chan 55 N42°03.34' W102°48.27' at fld. 3925/11E.

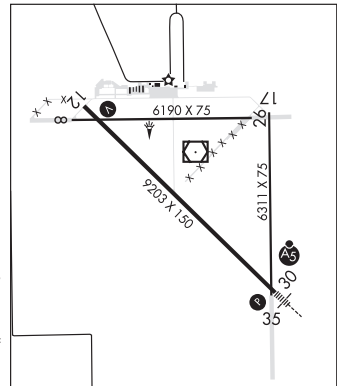
VOR unusable:

001°-058° byd 40 NM

059°-069° byd 40 NM blo 5,600'

070°-360° byd 40 NM

ILS/DME 108.35 I-BYE Chan 20(Y) Rwy 30. Class IE. Unmonitored.

**ALMA****ALMA MUNI** (4D9) 1 NE UTC-6(-5DT) N40°06.75' W99°20.79'OMAHA
L-10H
IAP

2073 B NOTAM FILE OLU

RWY 17-35: H3200X60 (CONC) MIRL 0.3% up N

RWY 17: PAPI(P2L)—GA 3.0° TCH 40'. Road.

RWY 35: PAPI(P2L)—GA 3.0° TCH 40'.

SERVICE: FUEL 100LL LGT ACTIVATE MIRL Rwy 17-35; PAPI Rwy 17
 and Rwy 35—CTAF. Beacon lgt clear and green.

AIRPORT REMARKS: Unattended. Self svc fuel avbl 24 hrs via credit card
 system. Unmarked, unlighted twr 6 NM northwest of arpt at 2458'
 MSL. Segmented circle concrete in ground.

AIRPORT MANAGER: 308-470-0563

COMMUNICATIONS: CTAF 122.9

® DENVER CENTER APP/DEP CON 132.7

CLEARANCE DELIVERY PHONE: For CD ctc Denver ARTCC at 303-651-4257.

