

|                        |                        |
|------------------------|------------------------|
| APP CRS<br><b>313°</b> | Rwy Idg<br><b>4500</b> |
|                        | TDZE<br><b>429</b>     |
|                        | Apt Elev<br><b>429</b> |



# RNAV (GPS) RWY 31

MOUNT CARMEL MUNI (AJG)


**NA** DME/DME RNP-0.3 NA. Visibility reduction by helicopters NA. When local altimeter setting not received, use Lawrenceville altimeter setting and increase all MDA 40 feet and increase LNAV Cat. D visibility ¼ mile.

**MISSED APPROACH:** Climbing left to turn 2500 direct NIYRI and hold.

|                        |   |                               |
|------------------------|---|-------------------------------|
| AWOS-3<br><b>134.9</b> | EVANSVILLE APP CON★<br><b>125.6 343.7</b> | UNICOM<br><b>122.7 (CTAF)</b> |
|------------------------|---|-------------------------------|

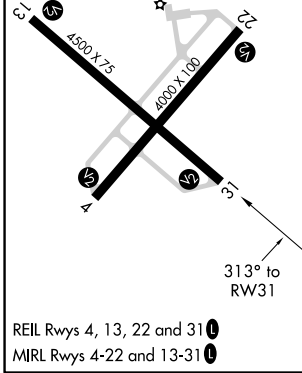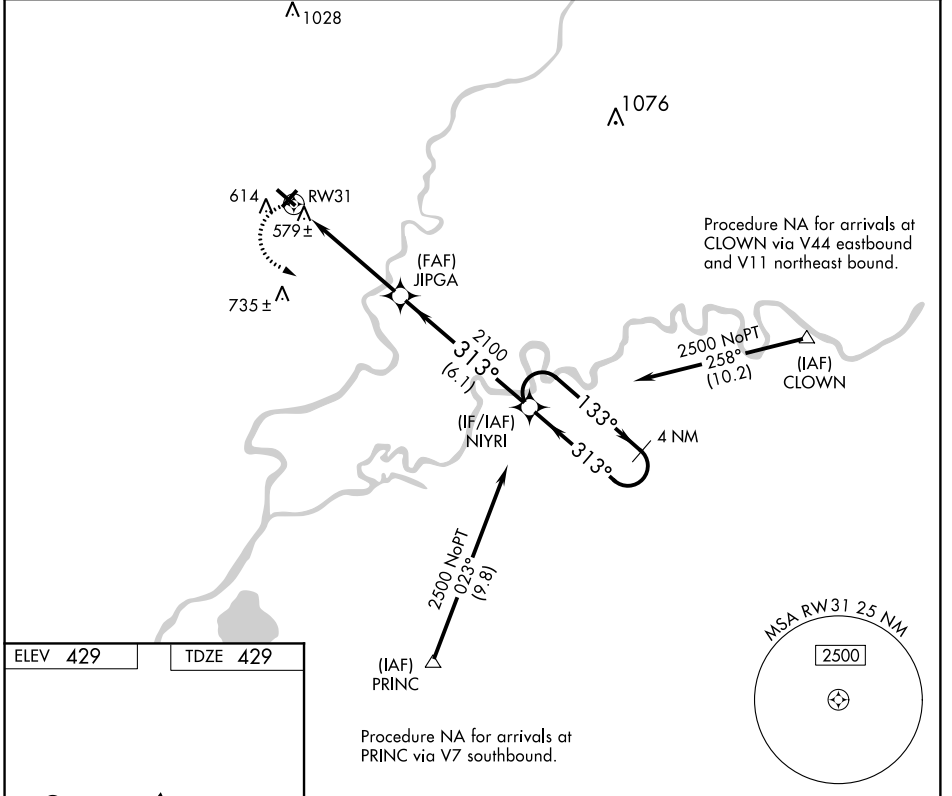

2500 NIYRI VGSI and descent angles not coincident (VGSI Angle 3.00/TCH 25). 4 NM Holding Pattern

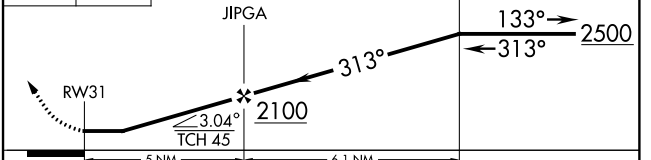

| CATEGORY | A     | B           | C      | D                     |
|----------|-------|-------------|--------|-----------------------|
| LNAV MDA | 840-1 | 411 (500-1) | 840-1¼ | 411 (500-1¼)          |
| CIRCLING | 980-1 | 551 (600-1) | 980-1½ | 980-2<br>551 (600-1½) |

EC-3, 17 AUG 2017 to 14 SEP 2017

EC-3, 17 AUG 2017 to 14 SEP 2017