

| | | |
|---|------------------------|---|
| LOC/DME I-BBG 111.35 Chan 50 (Y) | APP CRS 323° | Rwy Idg 7140 TDZE 1302 Apt Elev 1302 |
|---|------------------------|---|

ILS or LOC RWY 32


BRANSON (BBG)

NA Inop table does not apply. When local altimeter setting not received, use Harrison altimeter setting and increase S-ILS 32 DA to 1549 feet; increase all MDAs 60 feet and S-LOC 32 visibility Cat C/D and Circling visibility Cat C 1/4 SM. VDP NA when using Harrison altimeter setting.

MALSF

MISSED APPROACH: Climb to 4000 on heading 315° and HRO VOR/DME R-339 to WUTIB INT/HRO 25.3 DME and hold.

| | | | | | | |
|------------------------|--------------------------------------|--|-------------------------|--------------------------|--|-------------------------|
| ATIS 124.625 | SPRINGFIELD APP CON 126.35 | BRANSON TOWER★ 128.15 (CTAF) | GND CON 118.4 | CLNC DEL 118.4 | SPRINGFIELD CLNC DEL 126.35 (When tower closed) | UNICOM 122.95 |
|------------------------|--------------------------------------|--|-------------------------|--------------------------|--|-------------------------|

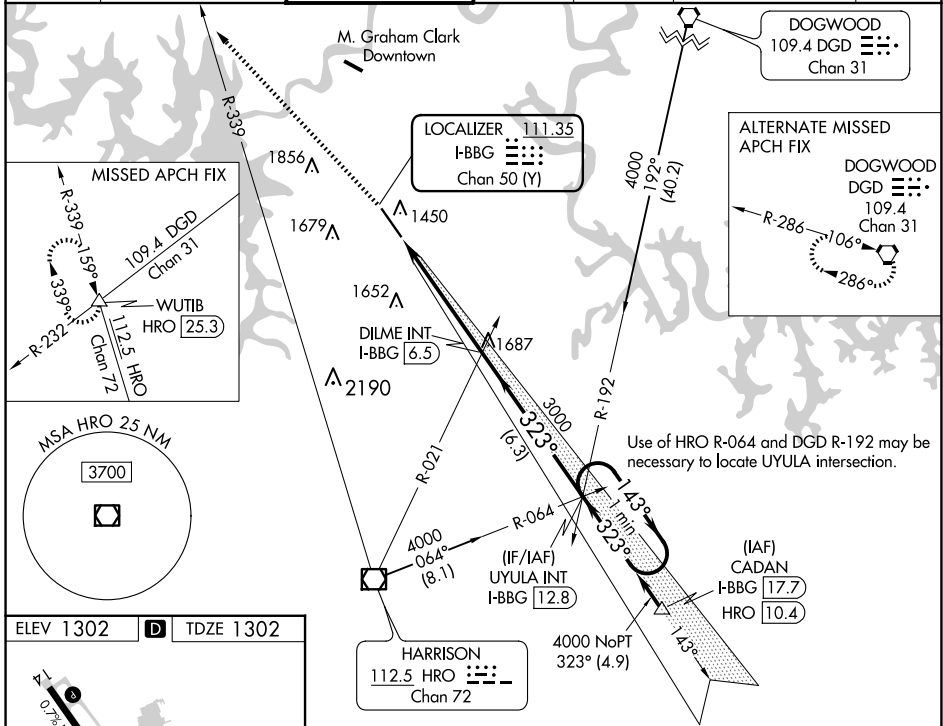


ELEV 1302 **D** TDZE 1302

TWR ☆

REIL Rwy 14 [L]
HIRL Rwy 14-32 [L]

FAF to MAP 5.1 NM

| | | | | | |
|---------|------|------|------|------|------|
| Knots | 60 | 90 | 120 | 150 | 180 |
| Min:Sec | 5:06 | 3:24 | 2:33 | 2:02 | 1:42 |

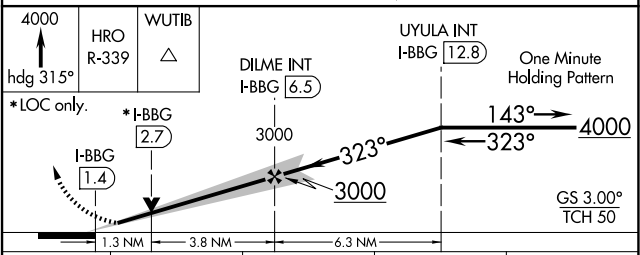

| CATEGORY | A | B | C | D |
|-------------------|-----------------------|-----------------------|--------------------------|------------------------|
| S-ILS 32 | | 1502-1 | 200 (200-1) | |
| S-LOC 32 | | 1760-1 | 458 (500-1) | |
| C CIRCLING | 1760-1 458 (500-1) | 1900-1 598 (600-1) | 2220-2¾ 918 (1000-2¾) | 2220-3 918 (1000-3) |

NC-3, 15 MAY 2025 to 12 JUN 2025

NC-3, 15 MAY 2025 to 12 JUN 2025