


RNAV (RNP) Z RWY 7R


TED STEVENS ANCHORAGE INTL (ANC) (PANC)

APP CRS	Rwy Idg	12400
072°	TDZE	132
	Apt Elev	151

Missed approach requires RNP less than 1.0. For uncompensated Baro-VNAV systems, procedure NA below -18°C (0°F) or above 54°C (130°F). GPS required. RF required. For inop ALSF, increase RNP 0.30 all Cats visibility to 1 1/2.

ALSF-2

MISSED APPROACH: Climb to 3000 on the missed approach route to JUKEP and hold.

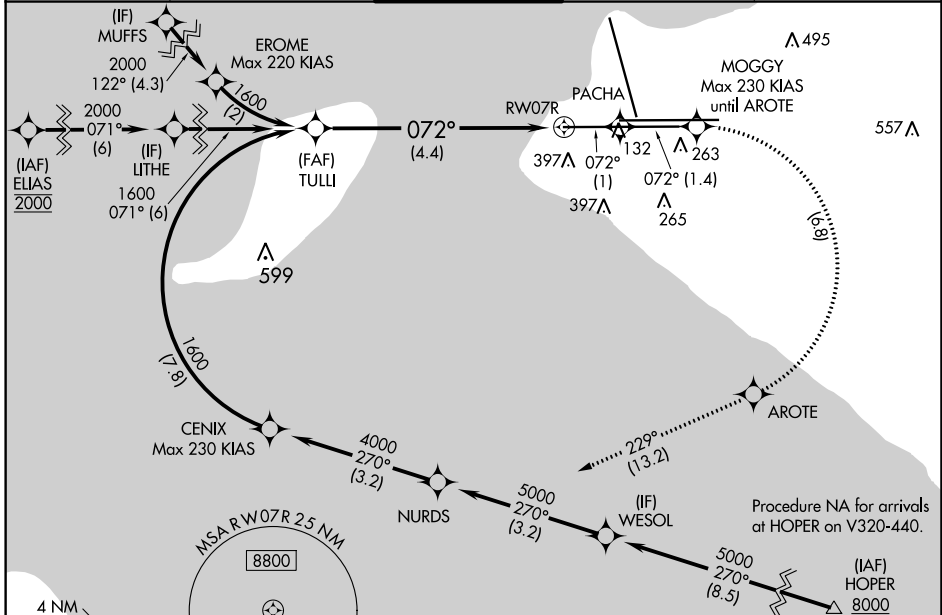
D-ATIS 135.5	ANCHORAGE APP CON 118.6 290.5	ANCHORAGE TOWER 118.3 257.8	GND CON 121.9 338.25	CLNC DEL 119.4 323.1
------------------------	---	---------------------------------------	--------------------------------	--------------------------------




AK, 12 OCT 2017 to 07 DEC 2017

AK, 12 OCT 2017 to 07 DEC 2017

RADAR REQUIRED

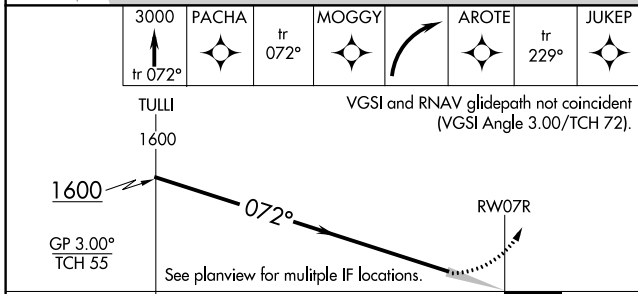

ELEV 151	D	TDZE 132
----------	----------	----------

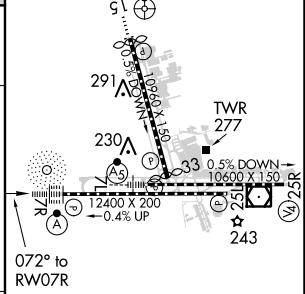

CATEGORY	A	B	C	D
RNP 0.30 DA	562/50 430 (500-1)			
AUTHORIZATION REQUIRED				

REIL Rwy 33
 TDZ/CL Rwys 7L and 7R
 HIRL all Rwys