

CALHAN (5V4) 1 N UTC-7(-6DT) N39°02.90' W104°17.58'
6450 TPA-7250(800) NOTAM FILE DEN

DENVER

RWY 17-35: 4565X50 (TURF-GRVL) LIRL(NSTD)

RWY 17: TRCV(TRIL). Road.

RWY 35: Trees. Rgt tfc.

SERVICE: S2 **FUEL** 100LL **LGT** Rwy 17-35 NSTD LIRL, north 3000' rwy lgtd. ACTIVATE NSTD LIRL Rwy 17-35 and VASI Rwy 17 CTAF.

AIRPORT REMARKS: Attended irregularly. Vehicles crossing rwy. Rwy 17-35 width varies from 50' to 100'. Rwy 17 first 1250' 45' wide artificial turf. Be alert, intensive USAF student training invof Colorado Springs and Pueblo Colorado. Aerobatic practice area 1/2 mile west of Rwy 17-35 300' AGL to 10,000' MSL. South end rwy has side slope. -6' ditch 40' west of centerline. Ground raises on east side of rwy. Rwy 17 has +4' fence 320' from thld and 3' ditch 290' from thld obstruction, +25' P-pole 400' from thld 110' R of centerline, +8' sign 340' from thld 70' R of centerline, +10' road 300' from thld obstruction. Rwy 17-35 has +4' fence 165' from and parallel to rwy centerline W side of rwy full length. Rwy 17-35 has +15' road 110' from and parallel to rwy centerline W side of rwy full length. Rwy 35 has +4' fence 200' from thld obstruction, +20' trees 70' west of centerline for first 500' of rwy, +25' P-line 850' from thld obstruction. See Special Notices USAF 306 FTG Flight Training Areas, Vicinity of Colorado Springs and Pueblo Colorado.

AIRPORT MANAGER: 719-338-2149

COMMUNICATIONS: CTAF/UNICOM 122.725

CANON CITY

FREMONT CO (1V6) 6 E UTC-7(-6DT) N38°25.71' W105°06.41'
5442 B TPA-6500(1058) NOTAM FILE DEN

DENVER

H-3F, 5A, L-10F

RWY 11-29: H5399X75 (ASPH) S-26, D-26 MIRL 1.1% up NW

RWY 11: REIL. PAPI(P2L)-GA 3.0° TCH 30'.

RWY 29: REIL. PAPI(P2L)-GA 3.0° TCH 40'.

RWY 17-35: 1800X35 (TURF-GRVL) 1.2% up N

RWY 17: Bldg.

SERVICE: S4 **FUEL** 100LL, JET A **OX 1, 2** **LGT** ACTIVATE REIL Rwy 11 and Rwy 29, PAPI Rwy 11 and Rwy 29, MIRL Rwy 11-29-CTAF.

AIRPORT REMARKS: Attended 1500-0000Z†. After hrs phone 719-429-3816. Parachute Jumping. Glider towing invof arpt. Glider ops on and invof arpt. Be alert, intensive USAF student training invof Colorado Springs and Pueblo Colorado. Rwy 17 has +32' hangar 1495' from thld 100' right of centerline. Rwy 17 has a 20' building 66' left of rwy centerline, 105' remaining from rwy end. 2' terrain W of Rwy 17-35 first 250' south of Rwy 11-29. Rwy 17-35 north 1491' grvl, south 1695' turf, Rwy 17-35 crosses asph twy and Rwy 11-29. Rwy 17-35 varies in width from 35' to 45'. Rwy 17-35 prairie dog holes throughout. All paved twys marked with blue and white reflectors. See Special Notices-USAFA 306 FTG Flight Training Areas, Vicinity of Colorado Springs and Pueblo Colorado.

AIRPORT MANAGER: 719-784-3816

WEATHER DATA SOURCES: AWOS-3 120.025 (719) 784-2014.


COMMUNICATIONS: CTAF/UNICOM 122.8

DENVER APP/DEP CON 120.1 (1300-0500Z‡)

DENVER CENTER APP/DEP CON 128.375 (0500-1300Z‡)

RADIO AIDS TO NAVIGATION: NOTAM FILE PUB.

PUEBLO (H) VORTAC 116.7 **PUB** Chan 114 N38°17.66' W104°25.77' 276° 33.0 NM to fld. 4759/8E.

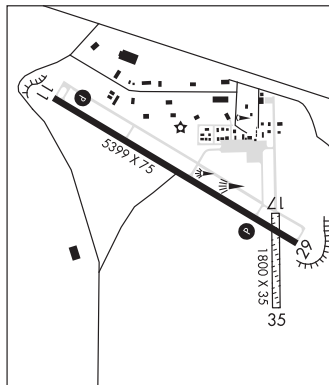

CASSE N39°27.12' W104°50.75' NOTAM FILE APA.

DENVER

NDB (HW/LOM) 260 **AP** 351° 7.1 NM to Centennial. 6415/8E.

L-10F, A

CENTENNIAL (See DENVER on page 261)