


WAAS CH 93601 W20A	APP CRS 206°	Rwy Idg TDZE Apt Elev	4410 955 957
--	------------------------	-----------------------------	---

RNAV (GPS) RWY 20

DAYTON-WRIGHT BROTHERS (MGY)

<p>▼ DME/DME RNP-0.3 NA. Inoperative table does not apply. If local altimeter setting not received, use James M Cox Dayton Intl and increase all DAs/MDAs 60 feet. Visibility reduction for helicopters NA. VDP NA when using James M Cox Dayton Intl altimeter setting.</p>	<p>MALS</p>	<p>MISSED APPROACH: Climb to 3100 direct SOVVO and hold.</p>
---	--------------------	---

ASOS 118.375	COLUMBUS APP CON 118.85 269.275	CLNC DEL 119.4	UNICOM 122.8 (CTAF) 0
------------------------	---	--------------------------	---------------------------------

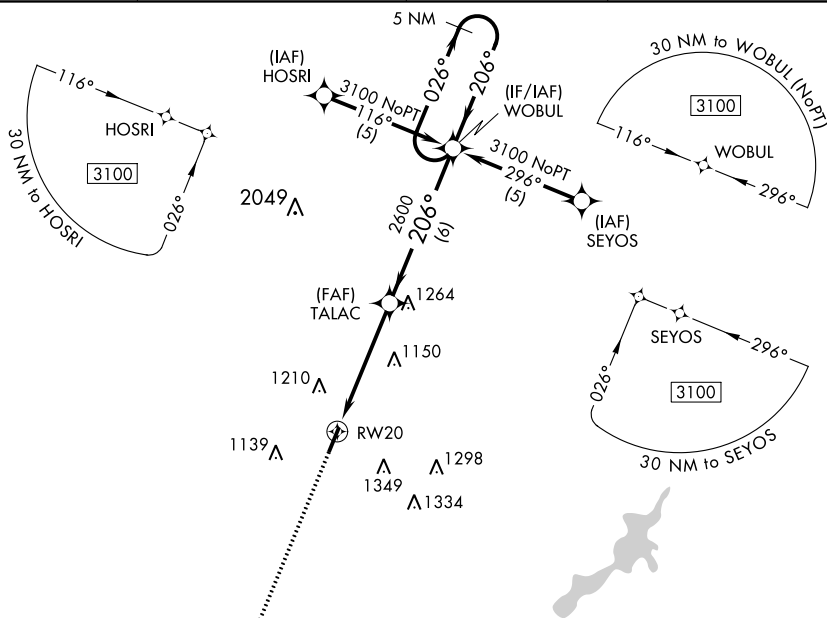


EC-2. 07 DEC 2017 to 04 JAN 2018

EC-2. 07 DEC 2017 to 04 JAN 2018

ELEV 957	D	TDZE 955
----------	----------	----------

MIRL Rwy 2-20 0

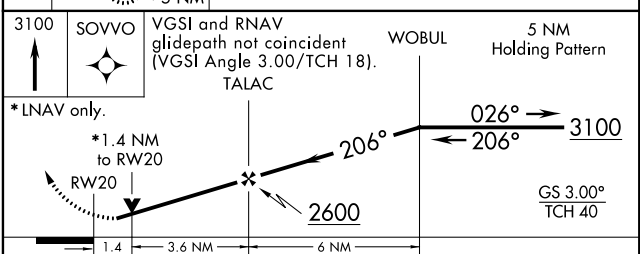

CATEGORY	A	B	C	D
LPV DA	1294-1¼ 339 (400-1¼)			
LNAV MDA	1440-1	485 (500-1)	1440-1½ 485 (500-1½)	1440-1½ 485 (500-1½)
CIRCLING	1480-1¼	523 (600-1¼)	1520-1½ 563 (600-1½)	1660-2¼ 703 (800-2¼)