

APP CRS 313°	Rwy Idg 4500
	TDZE 429
	Apt Elev 429



RNAV (GPS) RWY 31

MOUNT CARMEL MUNI (AJG)


NA DME/DME RNP-0.3 NA. Visibility reduction by helicopters NA. When local altimeter setting not received, use Lawrenceville altimeter setting and increase all MDA 40 feet and increase LNAV Cat. D visibility ¼ mile.

MISSED APPROACH: Climbing left turn to 2500 direct NIYRI and hold.

AWOS-3 134.9	EVANSVILLE APP CON★ 125.6 343.7	UNICOM 122.7 (CTAF)
------------------------	-------------------------------------------	-------------------------------

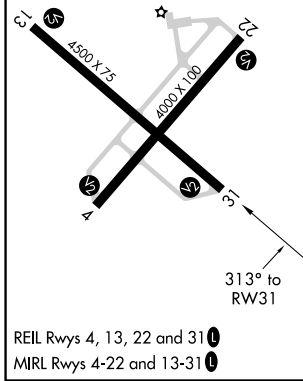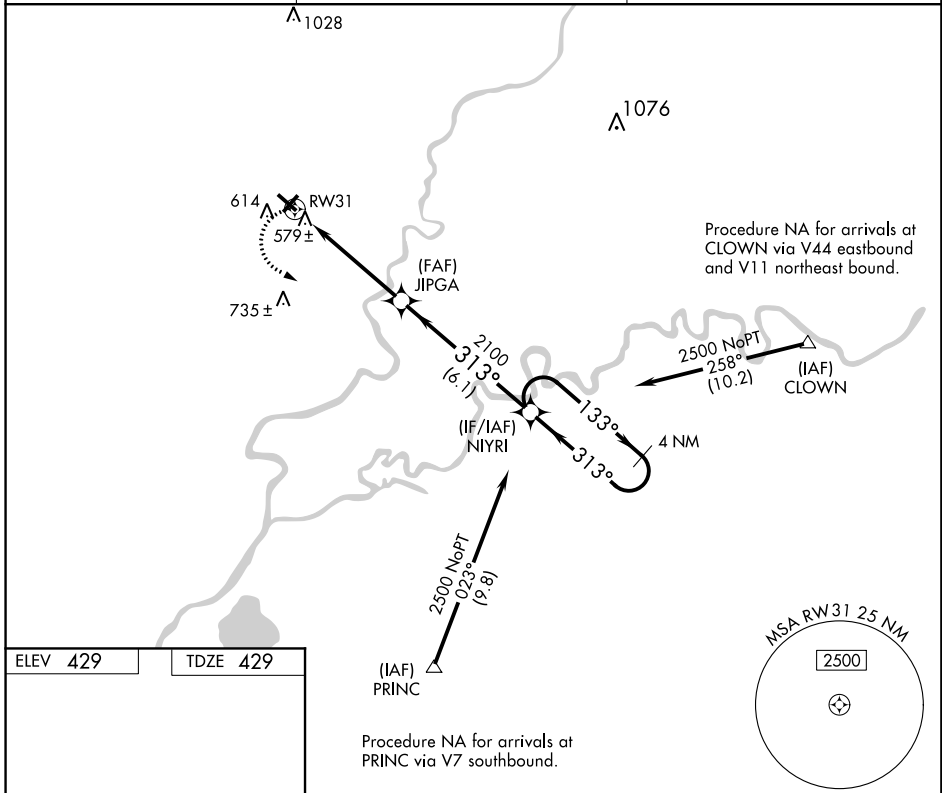

2500 NIYRI VGSI and descent angles not coincident (VGSI Angle 3.00/TCH 25). 4 NM Holding Pattern

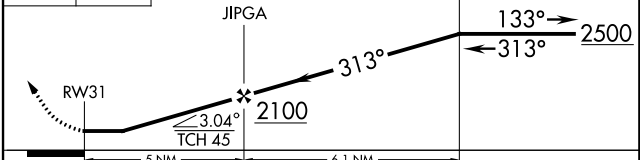

CATEGORY	A	B	C	D
LNAV MDA	840-1	411 (500-1)	840-1¼	411 (500-1¼)
CIRCLING	980-1	551 (600-1)	980-1½	980-2 551 (600-1½)

EC-3, 06 DEC 2018 to 03 JAN 2019

EC-3, 06 DEC 2018 to 03 JAN 2019